




1 Turn the indicator on and select a file



Turn on your Te Pari scale indicator by pressing the power button.


The **FILE LIST** screen is then displayed because you always need a file, on your scale, to save your records to.

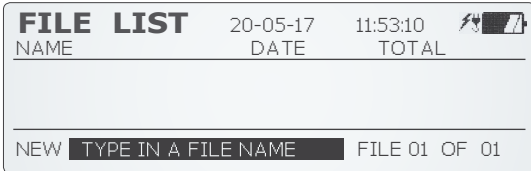

Key in a name for your session file, or arrow up to an existing file from a previous session on the list.

Press **RECORD/SELECT** to go to the to the main working screen.

2 Select your loadbars - For accurate readings it is vital that you have the correct loadbar settings.

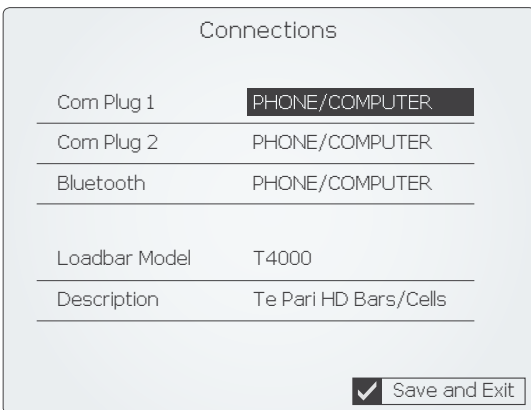

Press **SETUP/WEIGH** then arrow down to **CONNECTIONS** and press **RECORD/SELECT**.

Arrow down to **Loadbar Model** and using the left and right arrows select the loadbar model you have:

For Silencer Chutes - HD and Rancher models - select **T4000**.

For Silencer Chutes with an overhead scale system select **T6000**.


Arrow down to **Save and Exit** and press **RECORD/SELECT** to return to the **MAIN MENU**.

3 For best performance, before you start your weighing session:



- Check that nothing is touching; attached, or leaning against the chute, as this can place a load upon the loadbars or cells and produce inaccurate readings.
- Once checked press the **CLEAR** then the **ZERO** buttons on the scale indicator keypad, to correctly zero the scale.
- Ideally run the scale indicator from a constant power supply.

4 Connect your Dosing Gun

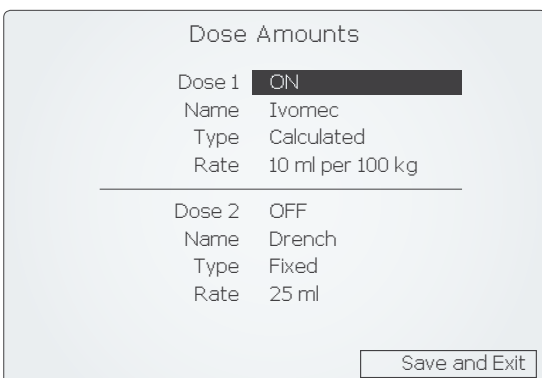

Your dosing gun will automatically connect to your scale indicator. You need to turn on the dosing setting by pressing **SETUP/WEIGH**, arrowing to **DOSING** then pressing **RECORD/SELECT**.

Turn **DOSE 1** to **ON**, then arrow to and set the **Name** and **Type**, then set **Rate** to the required dose rate.

Arrow to **Save and Exit** and press **RECORD/SELECT**, then press **SETUP/WEIGH** to return to the main working screen.